



SWITCH FUNCTION


NO. POLES	UL/CSA MODEL NO.	MODEL NO.	SWITCH FUNCTION			CONNECTED TERMINALS / SCHEMATIC		
			POS.1	POS.2	POS.3	POS.1	POS.2	POS.3
SP	Q1311	3MS1	ON	NONE	ON	2-3 	N/A	2-1
	Q1312	3MS2	ON	NONE	MOM			
	Q1313	3MS3	ON	OFF	ON			
	Q1314	3MS4	MOM	OFF	MOM			
	Q1315	3MS5	ON	OFF	MOM			
DP ▲ ▲	Q1321	3MD1	ON	NONE	ON	2-3,5-6 	N/A	2-1,5-4
	Q1322	3MD2	ON	NONE	MOM			
	Q1323	3MD3	ON	OFF	ON			
	Q1324	3MD4	MOM	OFF	MOM			
	Q1325	3MD5	ON	OFF	MOM			
	Q1326	3MD6	ON	ON	ON			
	Q1327	3MD7	MOM	ON	MOM			
	Q1328	3MD8	ON	ON	MOM			
3P	Q1331	3M31	ON	NONE	ON	2-3,5-6,8-9 	N/A	2-1,5-4,8-7
	Q1332	3M32	ON	NONE	MOM			
	Q1333	3M33	ON	OFF	ON			
	Q1334	3M34	MOM	OFF	MOM			
	Q1335	3M35	ON	OFF	MOM			
4P ▲ ▲	Q1341	3M41	ON	NONE	ON	2-3,5-6,8-9,11-12 	N/A	2-1,5-4,8-7,11-10
	Q1342	3M42	ON	NONE	MOM			
	Q1343	3M43	ON	OFF	ON			
	Q1344	3M44	MOM	OFF	MOM			
	Q1345	3M45	ON	OFF	MOM			
	Q1346	3M46	ON	ON	ON			
	Q1347	3M47	MOM	ON	MOM			
	Q1348	3M48	ON	ON	MOM			

MOM=MOMENTARY


▲ Please check the availability in advance before order






POLE OPTIONS

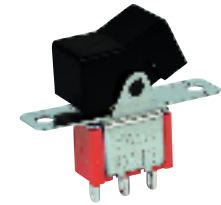


SPDT

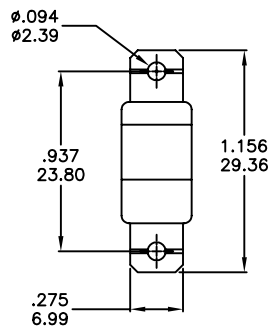




Part No. Shown : 3MS1R102M1QE

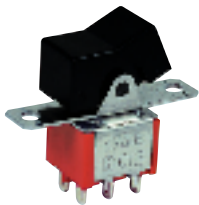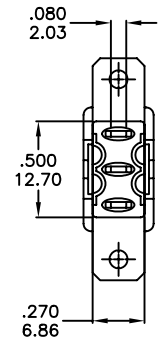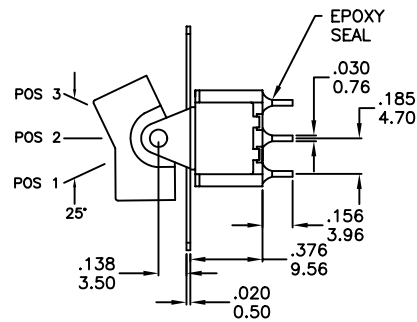


DPDT

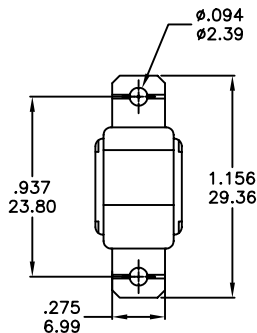




Part No. Shown : 3MD1R102M1QE

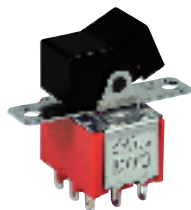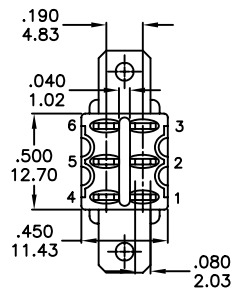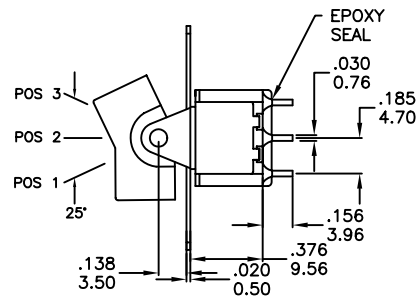


3PDT

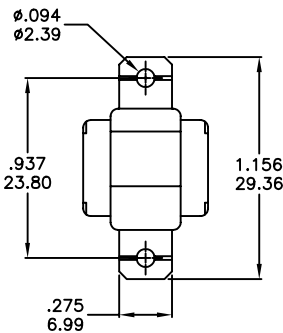

Part No. Shown : 3M31R102M1QE

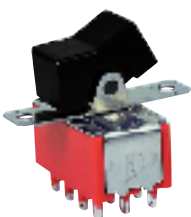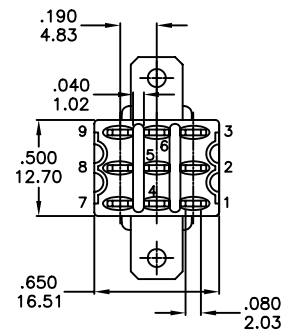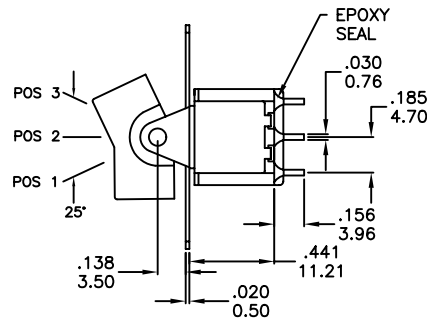

4PDT

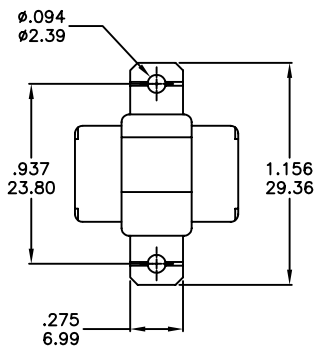

Part No. Shown : 3M41R102M1QE

